



EC144 60A

EC144 60A, Ammeter

Code: M1024A.

- > Scale: 90°, P2
- > Accuracy: 1,5
- > Measurement Range (A): 60
- > Modules: 144x144

Description

- No need for auxiliary power supply, only the CEC 96 type.
- DIN boxes with dimensions: 48, 72, 96 and 144.
- Measurement in true root mean square 100 mA . 100 A
- Exchangeable scales for EC48, EC72, EC96, EM 45, EC 72 FA, EC 96 FA
- The alarm system can be fully configured for CEC 96

Application

In alternating current applications, to control the state of the current quickly and visually.



EC144 60A

Moving Iron Milliammeters and Ammeter

Code: M1024A.

Specifications

Mechanical characteristics

| | |
|----------------------------------|-----------------------|
| Size (mm) width x height x depth | 144 x 144 x 71.8 (mm) |
| Weight (kg) | 0,43 |

Environmental characteristics

| | |
|---------------------|---|
| Protection class | Panel: IP 52 (Front), IP 00 (Terminals) |
| Storage temperature | -25...+40 °C |
| Working temperature | +10 ... +30 °C |

Standards

| | |
|---------------------------------------|--|
| Certifications | CE, UL |
| Electrical safety, Maximum height (m) | 2000 |
| Standards | BS 89, UNE-EN 60051, IEC 144, UL94, DIN 43780, IEC 51, UNE 21318 |

Current measurement circuit

| | |
|--------------------|--|
| Consumption | 0,3 ... 1,5 VA |
| Sampling frequency | 20...100 Hz |
| Allowable overload | 1,2 In permanent / 5 In during 30s / 10 In during 5s / 40 In during 1s |

Electrical characteristics

| | |
|-----------------------------|---|
| Insulation voltage, circuit | 2 KV, 50 HZ <1 min entre mecanismo y caja |
|-----------------------------|---|

Measurement accuracy

| | |
|----------|----------|
| Accuracy | 1,5 % FE |
|----------|----------|

EC-A

Moving Iron Ammeter

| CODE | TYPE | Scale | Accuracy | Measurement Range (A) | Modules |
|---------|----------|---------|----------|-----------------------|---------|
| M10212. | EC48 5A | 90°, P2 | 1,5 | 5 | 48x48 |
| M10213. | EC48 10A | 90°, P2 | 1,5 | 10 | 48x48 |
| M10214. | EC48 15A | 90°, P2 | 1,5 | 15 | 48x48 |
| M10215. | EC48 20A | 90°, P2 | 1,5 | 20 | 48x48 |
| M10216. | EC48 25A | 90°, P2 | 1,5 | 25 | 48x48 |
| M10217. | EC48 30A | 90°, P2 | 1,5 | 30 | 48x48 |
| M10218. | EC48 40A | 90°, P2 | 1,5 | 40 | 48x48 |
| M10219. | EC48 50A | 90°, P2 | 1,5 | 50 | 48x48 |



EC144 60A

Moving Iron Milliammeters and Ammeter

Code: M1024A.

| CODE | TYPE | Scale | Accuracy | Measurement Range (A) | Modules |
|---------|--------------|---------|----------|-----------------------|---------|
| M1021A. | EC48 60A | 90°, P2 | 1,5 | 60 | 48x48 |
| M10210. | EC48 .../5A | 90°, P2 | 1,5 | .../5 A | 48x48 |
| M10222. | EC72 5A | 90°, P2 | 1,5 | 5 | 72x72 |
| M10223. | EC72 10A | 90°, P2 | 1,5 | 10 | 72x72 |
| M10224. | EC72 15A | 90°, P2 | 1,5 | 15 | 72x72 |
| M10225. | EC72 20A | 90°, P2 | 1,5 | 20 | 72x72 |
| M10226. | EC72 25A | 90°, P2 | 1,5 | 25 | 72x72 |
| M10227. | EC72 30A | 90°, P2 | 1,5 | 30 | 72x72 |
| M10228. | EC72 40A | 90°, P2 | 1,5 | 40 | 72x72 |
| M10229. | EC72 50A | 90°, P2 | 1,5 | 50 | 72x72 |
| M1022A. | EC72 60A | 90°, P2 | 1,5 | 60 | 72x72 |
| M1022B. | EC72 75A | 90°, P2 | 1,5 | 75 | 72x72 |
| M1022C. | EC72 100A | 90°, P2 | 1,5 | 100 | 72x72 |
| M10220. | EC72 .../5A | 90°, P2 | 1,5 | .../5 A | 72x72 |
| M10232. | EC96 5A | 90°, P2 | 1,5 | 5 | 96x96 |
| M10233. | EC96 10A | 90°, P2 | 1,5 | 10 | 96x96 |
| M10234. | EC96 15A | 90°, P2 | 1,5 | 15 | 96x96 |
| M10235. | EC96 20A | 90°, P2 | 1,5 | 20 | 96x96 |
| M10236. | EC96 25A | 90°, P2 | 1,5 | 25 | 96x96 |
| M10237. | EC96 30A | 90°, P2 | 1,5 | 30 | 96x96 |
| M10238. | EC96 40A | 90°, P2 | 1,5 | 40 | 96x96 |
| M10239. | EC96 50A | 90°, P2 | 1,5 | 50 | 96x96 |
| M1023A. | EC96 60A | 90°, P2 | 1,5 | 60 | 96x96 |
| M1023B. | EC96 75A | 90°, P2 | 1,5 | 75 | 96x96 |
| M1023C. | EC96 100A | 90°, P2 | 1,5 | 100 | 96x96 |
| M10230. | EC96 .../5A | 90°, P2 | 1,5 | .../5 A | 96x96 |
| M10242. | EC144 5A | 90°, P2 | 1,5 | 5 | 144x144 |
| M10243. | EC144 10A | 90°, P2 | 1,5 | 10 | 144x144 |
| M10244. | EC144 15A | 90°, P2 | 1,5 | 15 | 144x144 |
| M10245. | EC144 20A | 90°, P2 | 1,5 | 20 | 144x144 |
| M10246. | EC144 25A | 90°, P2 | 1,5 | 25 | 144x144 |
| M10247. | EC144 30A | 90°, P2 | 1,5 | 30 | 144x144 |
| M10248. | EC144 40A | 90°, P2 | 1,5 | 40 | 144x144 |
| M10249. | EC144 50A | 90°, P2 | 1,5 | 50 | 144x144 |
| M1024A. | EC144 60A | 90°, P2 | 1,5 | 60 | 144x144 |
| M1024B. | EC144 75A | 90°, P2 | 1,5 | 75 | 144x144 |
| M1024C. | EC144 100A | 90°, P2 | 1,5 | 100 | 144x144 |
| M10240. | EC144 .../5A | 90°, P2 | 1,5 | .../5 A | 144x144 |



EC144 60A

Moving Iron Miliammeters and Ammeter

Code: M1024A.

Exchangeable scales. See next page




EC144 60A

Moving Iron Milliammeters and Ammeter

Code: M1024A.

Dimensions

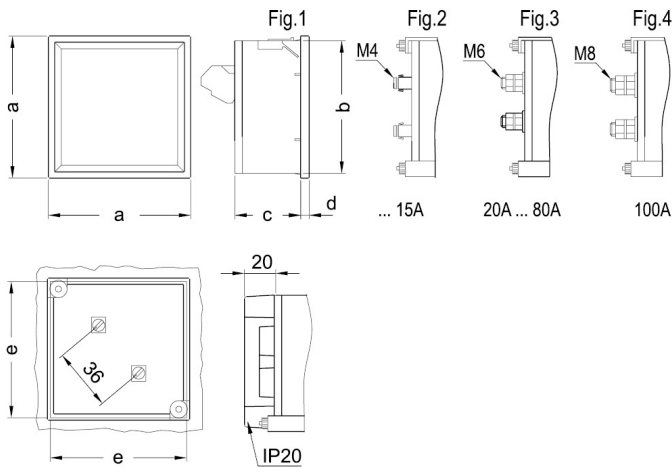

| Type | Fig. EC | Fig. BC | a | b | c | d | e |
|------|---------|---------|-----|------|------|-----|-----|
| 48 | 1-3 | 1-3 | 48 | 44,7 | 61 | 5,2 | 45 |
| 72 | 1-3-4 | 2-3-4 | 72 | 67,2 | 43,5 | 5,7 | 68 |
| 96 | 1-3-4 | 2-3-4 | 96 | 91 | 43,5 | 5,7 | 92 |
| 144 | 2-3-4 | 2-3-4 | 144 | 137 | 64,5 | 7,3 | 138 |

Connections

