

### **PIC96E 400V**

PIC96E 400V, Phasemeter

#### Code: M13639. DESCATALOGADO

- > Scale: 360°, P1
- > System: Unbalanced three-phase
- > Accuracy: 1,5
- > Measurement Range (V): 400
- > Modules: 96x96

#### Description

- Does not need an auxiliary power supply
- $\circ~$  DIN box with dimensions 96 and 144.
- Class 1.5
- Balanced and unbalanced single and three-phase circuits.
- 4 quadrants

### Application

Measurement of  $\cos \phi$  in balanced or unbalanced single and three-phase circuits.

## Circutor



## **PIC96E 400V**

Phasemeters

Code: M13639.

### Specifications

Size (mm) width x height x depth	96 x 96 x 101.2 (mm)
Fastening	Panel
Weight (kg)	1,41
invironmental characteristics	
Protection class	Panel: IP 52 (Front), IP 00 (Terminals)
Storage temperature	-25+40 °C
Working temperature	+10 +30 °C
Standards	
Certifications	CE, UL
Electrical safety, Maximum height (m)	2000
Standards	BS 89, UNE-EN 60051, IEC 144, UL 94, DIN 43780, IEC 51, UNE 21318
Current measurement circuit	
Consumption	2,5 VA
Sampling frequency	20 100 Hz
Nominal current (In)	5 A
Allowable overload	1,2 In permanent / 5 In during 30s / 10 In during 5s / 40 In during 1
/oltage measurement circuit	
Consumption	15 mA
Sampling frequency	45 55 Hz / 54 66 Hz
Electrical characteristics	
Insulation voltage, circuit	2 kV a 50 Hz <1 min entre mecanismo y caja
Measurement accuracy	
Accuracy	±1,5 % FE

Current range: 0.1 to 1.2 In. For the connection of transformers .../5A.






### **PIC96E 400V**

Phasemeters

Code: M13639.

Dimensions

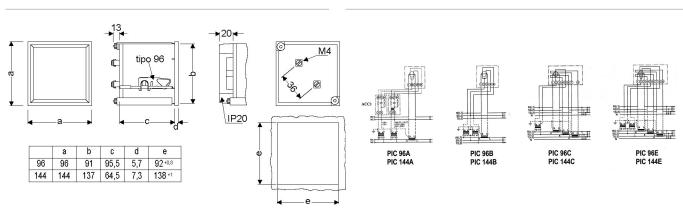

Connections

# Circutor